



Tax ID: 56-2658523
 17903 West Strack Drive
 Spring, TX 77379

To: Courtney Clifford
 Tel. #: (301) 602-9800 -Courtne
 Fax #: (
 Email: cbclifford48@gmail.com
 ALD Telephone: (281) 355-0055
 ALD Fax: (281) 355-5621

INVOICE 47392

Account (Location):
 Webster Presbyterian Church
 201 Nasa Road 1
 Webster, TX 77598

Other Account Information:
 Webster Presbyterian Church
 201 Nasa Road 1
 Webster, TX 77598

Service Date	11/15/2016	Technician	Emilio S	Ticket Number	54719
Invoice Date	Nov 15, 2016	Terms	Due Upon Receipt	Type	2-H/O (Acct)
Order #		PO #		ALD Contact	AMANDA

Description	Amount
Commercial - Detection -	\$500.00
TOTAL	\$500.00

Invoice Description :

54719 (\$500.00 PAID IN FULL) 11/15/16 - COMMERCIAL DETECTION - Emilio Sanchez

Technician ran a camera through the office building men and women's 4 inch roof vent stack and a video inspection found the cast iron drain lines to be in fair conditions, deteriorated, channeled in with build up. The drain exit was traced to the front of the office building with no cleanout available. No blockages were found at this time.

A camera was run through the storm drain register and found the main 12 inch PVC line to be in good conditions. A second register was located by the building entrance underneath the dirt. The storm drain register was excavated. A third register was located at the rear of the building and to be full of dirt and roots inside the register 6 inch and 8 inch pipe.

A camera was unable to be run through the 8 PVC storm drain pipe due to the line being full of dirt and roots. The line and register will need to be cleared.

A camera was run through the 6 inch office atrium storm drain line and found to be in good conditions with no breaks at this time. No storm drain register cover was found. It is recommended to install a cover to prevent debris inside the register and pipe.

The estimated cost to install a 4 inch two way PVC cleanout, labor and materials included, 5 year warranty is \$14050.00 (sh)

PAID CHECK#1791 \$500.00 11/15/16

PAID

Operates under License TMPL#39199 919 E. 41st St - P.O. Box 4200 Austin, TX 78765 512.458.2145 - FAX 512.450.0637 - 1.800.845.6594
 ** PLEASE DETACH THIS PORTION AND RETURN WITH PAYMENT **


American Leak Detection of Houston

Tax ID: 56-2658523
 17903 West Strack Drive
 Spring, TX 77379

Phone: (281) 440-4400
 (281) 355-0055 for Billing
 Fax: (281) 355-5621

Account 2813321251
 Invoice # 47392
 Amount \$ 500.00
 Paid \$500.00

Interest will be charged at a rate of 1.5% per month on accounts over 30 days.
 We accept all major credit cards. Please write invoice number on check.

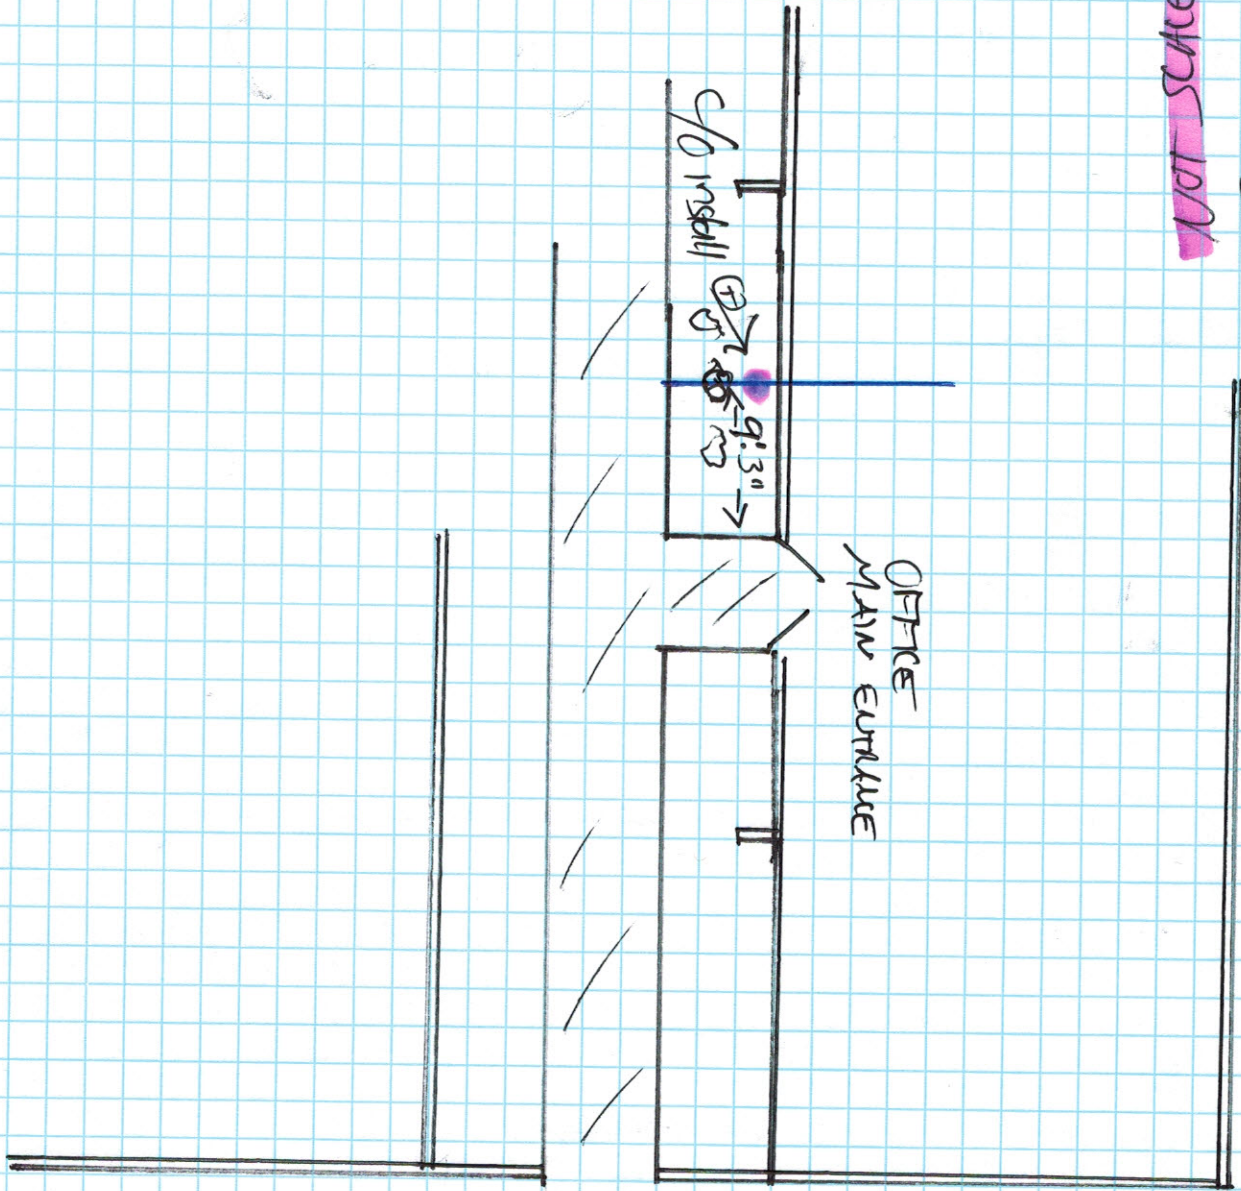

NOT SCALE

FRONT
 Webster Presbyterian Church
 201 NASA Rd. 1
 Webster, TX 77598

NASA PARKWAY

HOUSTON ST.